


## MAGNETIC MEASURING



## INFORMATION

## Magnetic Field Measuring

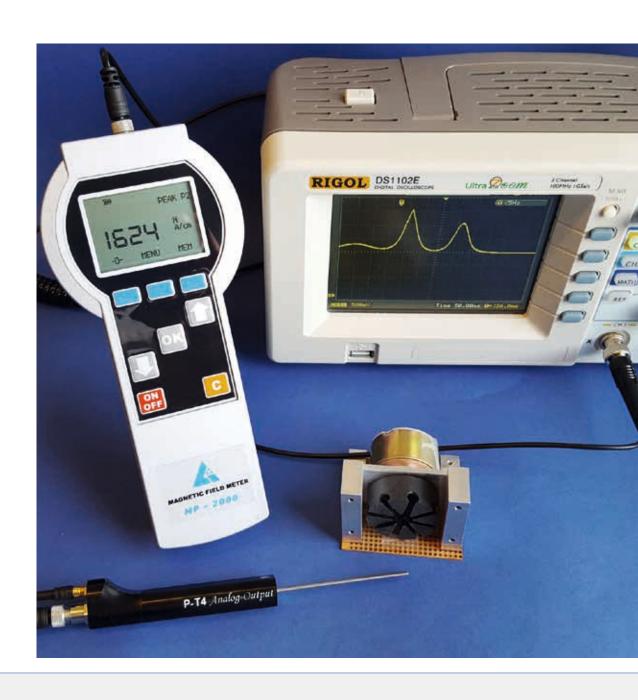

Magnetic fields are invisible. The magnetism of a workpiece can only be recognized by the effect on other steel parts or chips. Often, however, residual magnetism is an undesirable effect, and that is why it is increasingly the subject of quality audits. Magnetism is also an important component of mechanical engineering. Without a magnet, there is no electric motor. The functionality of a magnetic switch depends on the strength of the actual magnet. For the magnetization of ferrite or neodymium materials, strong magnetic fields are required, which must be dynamically measurable during generation.

Our company name, "List-Magnetik", speaks for itself. For decades, magnetization and magnetic field measurements have been our core competences. Behind all of our customerspecific magnetizing systems, demagnetizing devices and the serial production of magnetic measuring devices, are our many years of comprehensive experience and well-founded know-how. Our measuring instruments recognize both magnetic fields with the minimum strength of the earth's magnetic field, as well as strong pulse fields, which enables us to meet all of your application requirements. We offer technically advanced solutions "Made in Germany", from the small hand-held compact device to the analog display on the oscilloscope, Special equipment such as flux meters and permeability measuring devices complete our range of services.



## MP-800 Magnetic Field Meter

The smallest and most attractive magnetic field meter

The addition to our series of precise magnetic field measurement devices: The small, compact and attractive hand instrument LIST-MAGNETIK MP-800 is easy to operate and comfortable to use.

To measure accurately all kinds of magnetic fields: AC fields, DC fields and maximum values in impulse fields.



The measurement ranges and different units A/cm, kA/m, Gauss/Oersted, Tesla fulfill every requirement .

#### Magnetic field measurement in new design

MP-800 is available with fixed axial probe (MP-800 A) or

with **tangential probe** (MP-800T).

The axial field probe measures the field in direction of the probe axis in precise distance

direction of the probe axis in precise distance of 2 mm. It is suitable for measurement on plain surfaces, or specifically in drilled holes.

The tangential field probe measures in 90 degree angle to the probe axis particularly in air gaps, cavities and on the surface of workpieces, suitable for crack detection.





 Measuring directions with axial and tangential probe

## **MP-2000**

Magnetic Field Meter

With the magnetic field meter LIST-MAGNETIK MP-2000, we offer you a first class, high-end product, with externally connectable axial and tangential field probes. With the easy to use device, you can precisely measure magnetic DC and AC fields as well as pulse fields of all kinds. The range of application ranges from the earth's magnetic field to a field strength of 40,000 A/cm, switchable in Gauss/Oersted and Tesla. The built-in data logger, the combined digital and analog display as well as the optional data transfer via USB, allows flexible use.

Especially at high magnetic field strengths, an absolutely interferencefree and precise measurement is required. For this reason, a microcontroller digitizes and linearizes the analog measuring signals of the Hall sensor into the probe in the measuring probes of the MP-2000.

The fast peak value memory allows measurements in pulse fields from 0.1 m/sec. In addition, an oscilloscope for the representation of dynamic magnetic fields can be connected via the special probe P-T4A with analog output. A further advantage is that the probe cable can be plugged in on both sides connects the display unit and the probe and can be easily replaced in the event of a cable fault.

The universally applicable MP-2000 tests for residual magnetism, measures magnetic fields of all types and locates stray detectors for crack detection.



## MP-1000 Magnetic Field Meter



The LIST-MAGNETIK MP-1000 magnetic field meter is a handy universal device with externally connectable tangential and axial field probes for the precise measurement of all types of magnetic fields: steady DC fields, alternating AC fields and pulsed fields.

With the easy one-button operation, magnetic field strength can be measured from the weak earth magnetic field up to strong fields of 20,000 A/cm, switchable in Gauss/Oersted.


A separate built-in micro controller in the MP-1000's measuring probes digitizes and linearizes the analog measurement signals of the hall sensor into the probe. This gives an extremely trouble-free and precise measurement, especially at high magnetic field strengths. The probe cable is pluggable at both ends, at the display unit and the probe, which is particularly service-friendly, as the cable can simply be replaced if it becomes faulty. Applications of the MP-1000 are the test for residual magnetism, the measurement of magnetic fields of all kinds, as well as the localization of stray fields for crack detection.

# List-Magnetik

## LIST-MAGNETIK

## **MEASURING PROBES**

## for Magnetic Field Meters MP-1000, MP-2000 and MP-5000

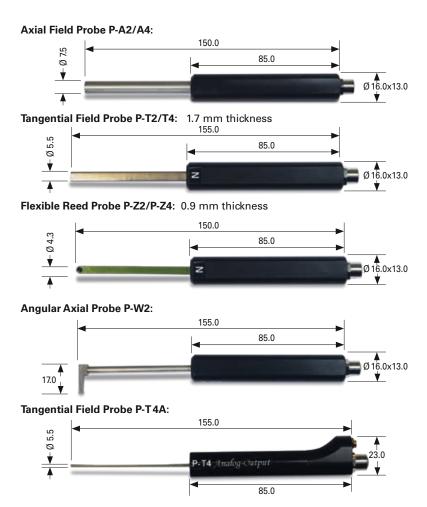

For the Magnetic Field Meters MP-1000, MP-2000 and MP-5000 these axial field, tangential field and flexible reed probes are available.

All probes are of plug-in design.

| Model MP-                                   | 1000 | 2000     | 5000     |
|---|------|----------|----------|
| Axial Field Probe P-A2                      |      | ~        | <b>/</b> |
| Measuring range 0-20.000 A/cm               |      |          |          |
| Tangential Field Probe P-T2                 |      | ~        | ~        |
| Measuring range 0-20.000 A/cm               |      |          |          |
| Flexible Reed Probe P-Z2                    |      | ~        | ~        |
| Measuring range 0-20.000 A/cm               |      |          |          |
| Angular Axial Probe P-W2                    |      | ~        | ~        |
| Measuring range 0-20.000 A/cm               |      |          |          |
| Axial Field Probe P-A4                      |      | <b>/</b> | ~        |
| Measuring range 0-40.000 A/cm               |      |          |          |
| Tangential Field Probe P-T4                 |      |          | ~        |
| Measuring range 0-40.000 A/cm               |      |          |          |
| Flexible Reed Probe P-Z4                    |      |          | ~        |
| Measuring range 0-40.000 A/cm               |      |          |          |
| Tangential Field Probe P-T4A                |      |          |          |
| Analog Output                               |      |          |          |
| with BNC cable as output to an oscilloscope | _    | <b>V</b> | _        |
| Measuring range 0-40.000 A/cm               |      |          |          |
| (picture see title page)                    |      |          |          |

#### Checking with Precision Calibration Standard

It is not necessary to calibrate the device - it is pre-calibrated at the factory.

A precision calibration standard with 180 A/cm is available as an option, in order to be able to check the device.

If a deviation is detected when checking with the precision calibration standard, we advise returning the device for recalibration at the factory.

#### **Axial Field Probe**

Insert the sensor vertically into the red-bordered cut-out in the calibration standard and turn the device until the max. value is displayed. Compare the value displayed with the value of the calibration standard.

#### **Tangential Field Probe**

Insert the probe into the side slot on the calibration standard with the "N" marking (north pole) upwards, until the probe latches into place at the front. Compare the value displayed with the value of the calibration standard.



### **MP-5000**

## Laboratory and process instrument

The measurement of magnetic fields with handsets is quite practical, but when it comes to the automated use in a process chain, battery-powered devices with unidirectional interface are not sufficient. If you need to measure magnetic fields in the process flow, transfer the results directly to the process control, and derive immediate analyzes, then you need a device with high measurement accuracy and integration capability:

#### **LIST-MAGNETIK MP-5000.**

With RS232 / USB interface and graphic control panel.

Via the interface you can integrate the device into your production environment, control the measurement and use the feedback for decision-making in the process chain.



### **MP-1**

## Residual Magnetic Field Meter

With the handy, battery-powered Residual Magnetic Field Meter LIST-MAGNETIK MP-1, you quickly and reliably determine residual magnetism on ferromagnetic iron and steel parts. The measuring device can also be used for checking demagnetized parts.

The two measuring ranges of the analog display of 0-5 A/cm and 0-20 A/cm correspond to the industry standard of the ball bearing industry. The Hall sensor in the axial field probe is located at a defined measuring distance of 2.0 mm from the measuring surface.





### **Ferromaster**

## Permeability Meter

With the Magnet permeability meter Ferromaster you can easily measure the relative magnetic permeability  $\mu r$  of feebly magnetic materials and workpieces with a permeability between 1.001 and 1.999.

The permeability is measured by touching the workpiece with the probe tip and reading the result from the display.

Typical applications are: non-destructive testing of materials, e. g. quality control of stainless steel, material selection for electron-/ion-beam equipment, detection of material defects induced by mechanical or thermal stress.



## **FL-4** Fluxmeter

The Fluxmeter FL-4 is a measuring device for the determination of the magnetic flux  $\Phi$  (Phi) of a magnet system or a single magnet.

In combination with the List-Magnetik Helmholtz moment coil HM-1, the magnetic flux of permanent magnets can be determined very accurately, since the entire volume of the magnet is measured independently of position. The effect of the magnet on the coil is determined in the form of an electrical voltage and converted into the flux value. Technically speaking, the Fluxmeter FL-4 is an electronic analog voltage integrator.



## Performance table and technical Data MP-800 - MP-2000 - MP-1000 - MP-1

|                                   | MP-800 A  | MP-800T   | MP-2000  | MP-1000  | MP-1   |
|-----------------------------------|---|---|--|--|--|
| Measuring units:                  | A/c   | m – kA/m – Gauss(Oe) – T<br>switchable  | A/cm – Gauss(Oe)<br>switchable   | A/cm   |  |
| Measuring probe                   | Axial field probe ø 8mm<br>with defined measuring<br>distance of 2.0 mm                               | Tangential field probe of<br>1.7 mm thickness with<br>Hall Sensor distance of<br>0.9 mm | Axial probes<br>P-A2, P-W2 and P-A4,<br>Tangential probes<br>P-T2, P-T4, P-Z2, P-Z4<br>and P-T4A | Axial probes<br>P-A2 and P-W2<br>Tangential probes<br>P-T2 and P-Z2    | Axial field probe Ø 8 mm<br>with defined measuring<br>distance of 2.0 mm |
| Measuring range DC                | 0-15.000 A/cm   |   | 0-20.000 A/cm  | 0–5 A/cm and 0–20 A/cm   |  |
| Measuring range AC                |   | _   |  |  |  |
| Accuracy in the homogeneous field | ± 2%  |   | 0-20.000 A/cm ± 2%,<br>> 20.000 A/cm ± 3%<br>of the displayed value                              | ± 2%<br>of the displayed value   | ± 3%   |
| Resolution                        | 200-600 A/cm: 1 A/cm,   |   | 0-200 A/cm: 0.1 A/cm,<br>> 200 A/cm: 1 A/cm,<br>> 10.000 A/cm: 10 A/cm                           | 0-100 A/cm: 0.1 A/cm,<br>> 100 A/cm: 1 A/cm,<br>> 10.000 A/cm: 10 A/cm | -  |
| Frequency range AC                |   | _   |  |  |  |
| Peak hold                         |   | _   |  |  |  |
| Display                           | OLED Graphic Display illuminated  OLED Graphic Display illuminated  analog display of measured values |   | LCD-Anzeige 3 digit  | Analog scale with 2 ranges, colored tolerance ranges                   |  |
| Multilingual menu navigation      | German / English German/English/ Spain/<br>Dutch  |   |  | _  | -  |
| Data logger                       |   |   | 10,000 measurements, divisible into 100 batches  | _  | _  |
| Statistics                        | Count / Maximum / Minimum / Average / Standard deviation –  |   |  |  | _  |
| Interface                         | Bluetooth interface class 2 for communication with PC, MP-800 App and printer                         |   | RS232 interface with<br>USB cable for<br>communication with PC<br>and printer                    | -  | -  |
| Power supply                      | 1 x 1.5 V AA Mignon   |   | 3 x 1.5 V AA Mignon  | 2 x 1.5 V AA Mignon  | 1 x 1,5 V battery (Baby)<br>with battery display                         |
| Operating time                    | approx. 30 hours  |   | approx. 50 hours   | approx. 35 hours   | approx. 100 hours  |
| Dimensions                        | Ø 28 x 180 mm   |   | 198 x 92 x 35 mm   | 105 x 65 x 26 mm   | 83 x 122 x 40 mm   |
| Weight                            | 97 g with battery   |   | 265 g with batteries   | 137 g with batteries   | ca. 300 g with probe and battery   |

1 A/cm = 0.1 kA/m = 1.256 Gauss = 1.256 Oersted = 0.1256 mT (Millitesla)



**List-Magnetik Dipl.-Ing. Heinrich List GmbH**Max-Lang-Straße 56/2
D-70771 Leinfelden-Echterdingen

Phone +49 (711) 903631-0 Fax +49 (711) 903631-10 info@list-magnetik.de www.list-magnetik.de

